



# SUPER PURGE

## Floor Finish Solubilizer

### DESCRIPTION

A unique floor finish re-emulsifier and extra heavy-duty stripper, designed for use in heavy build up areas that have been high speed burnished. Comprised of synergistic solubilizers in combination with emulsifiers, chelating and anti-redeposition agents, and a new type of penetrant in a pH controlled base, allows a speed and efficiency never before attainable.

### PRODUCT FEATURES / BENEFITS

- Formulated with extra solubilizers / Liquified finish stays in stripped solution longer without evaporating too quickly.
- Fast multiple coat penetration / Minimizes stripping time to reduce labor costs
- Removes all build-ups due to repeated burnishing / Allows for reduced product inventory making it a one product process
- pH and odor controlled / Reduces hazardous vapors and reduces potential tile damage
- Allows stripping without the necessity of a scrubbing machine / Reduces equipment costs and allows the product to be used in small areas where machine scrubbing is impractical.

### DIRECTIONS FOR USE

**Wet-Vac/Mop stripping:** Dilute with hot, cold, hard or soft water for use. The amount of the solubilizer for each stripping job will depend upon the amount of finish buildup on the floor.

Heavy Duty ..... 1 part solubilizer to 4 parts water.  
Light/ Medium Buildup: ..... 1 part solubilizer to 8 parts water.

Apply floor finish solubilizer liberally to the floor, using an area small enough to complete in 20-30 minutes (to avoid drying). Allow the solubilizer to stand for 5 minutes, then pick up the liquified finish with a squeegee equipped wet vacuum. When applying solubilizer to a new section of floor, re-wet the previously stripped section. Repeat this procedure until the floor is

completely stripped. Rinse thoroughly with clear water and mop or vacuum dry. Floor Machine Stripping Systems:

#### Floor Machine Stripping:

Heavy Duty ..... 1 part solubilizer to 6 parts water.  
Light/ Medium Buildup: ..... 1 part solubilizer to 16 parts water.

Follow the manual directions above, except agitate well with a floor machine equipped with a stripping pad and remove solubilized finish with a wet vacuum and rinse.

**Note: Asphalt tile, Linoleum, and other sensitive floor surfaces may be damaged by contact with stripping solution. We recommend that a spot test be conducted before general use.**

### SPECIFICATIONS

Color ..... Blue  
 Odor ..... Sassafras  
 pH ..... 13.4 ± 0.2  
 Specific Gravity (g/cc) ..... 1.04 ± 0.01  
 Density (lbs/gal) ..... 8.7 ± 0.1  
 Viscosity (cps) ..... <10  
 Flash Point (TOC) ..... None

Solubility ..... Complete  
 Upper Cloud ..... > 140°F  
 Lower Cloud ..... < 34°F  
 Finish Penetration ..... Milky less than 20 seconds  
 Wax Removal ..... Excellent  
 Shelf Life ..... 1 year minimum in original unopened container

### SAFETY INFORMATION

**DANGER:** CAUSES SEVERE SKIN BURNS AND EYE DAMAGE. KEEP OUT OF THE REACH OF CHILDREN.



#### Precautionary statement

**Prevention:** Do not breathe mist or vapor. Wash thoroughly after handling. Do not eat, drink or smoke when using this product. Use only outdoors or in a well-ventilated area. Wear protective gloves/protective clothing/eye protection/face protection.

**Response:** If swallowed: Rinse mouth. Do NOT induce vomiting. If on skin (or hair): Take off immediately all contaminated clothing. Rinse skin with water/shower. If inhaled: Remove person to fresh air and keep comfortable for breathing. If in eyes: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Immediately call a

poison center/doctor. Wash contaminated clothing before reuse.

**Storage:** Store in a well-ventilated place. Keep container tightly closed. Store locked up.

**Disposal:** Dispose of contents/container in accordance with local/regional/national/international regulations.


This product is a "Hazardous Chemical" as defined by the OSHA Hazard Communication Standard, 29 CFR 1910.1200.

All components are on the U.S. EPA TSCA Inventory List.

#### Additional safety measures:

Read the entire label and SDS before using this product, and for additional first-aid measures. SDS for this product is available on the web at [www.nclonline.com](http://www.nclonline.com)

For Commercial and Industrial Use Only

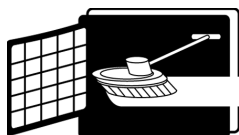

Stripper



401 N. 10th Street • Philadelphia, PA 19123  
1-800-NAT-CHEM • 215-922-1200 • FAX: 215-922-5517  
[www.nclonline.com](http://www.nclonline.com) • e-mail:[info@nclonline.com](mailto:info@nclonline.com)